

LAND CORNER RECORD

Index: E12	Corner: E1/16 cor. between Section 4 and Section 9	<i>State of Indiana - Hoosier National Forest</i>		
Section: 4	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1389933.01	Lon./E: 3143835.63	Datum: NAD83(sft)	


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:		Surveyor:	Monument:	Recording Information:		Monument Photograph:
10/05/2000		Raymond Graham	1/2 inch Rebar	Instr # 2000016903		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:		
Evidence Found:						
Monument Found:	1/2 inch Rebar					
2.) Date of Survey:		Surveyor:	Monument:	Recording Information:		
8/11/2010		Doug Curry	Rebar	Plat Cab. "D", Envelope 99		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:		
Evidence Found:						
Monument Found:	Rebar					

ACCESSORIES: Describe new BTs & witness objects established to perpetuate existing evidence.

Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Poplar with Mag Nail	16 inch	N 18° W	24.30 ft
	Red Oak with Mag Nail	22 inch	N 66° E	17.72 ft
	Red Oak with Mag Nail	17 inch	S 8° W	12.15 ft
	Rebar	0.5 inch	S 74° E	1.15 ft
Monument Found or Set:	A 5/8-inch rebar with a plastic yellow cap was found 0.6' above grade.			


MONUMENT SKETCH

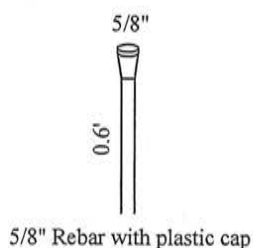

NARRATIVE REFERENCE: (Describe location relative to nearby features: roads, fences, terrain features, etc..)

The location of this monument is approximately 460 feet southwest from Camper Park Clearing and approximately 25 feet East of a North-South oriented ridgetop. This monument resides on an Easterly facing slope.

SECTION DIAGRAM

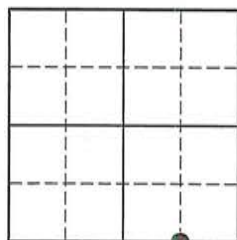

PERPETUATION RECORD: (Describe work done to perpetuate or preserve the existing monument or position)

East Sixteenth corner between Section 4 and Section 9; A stone was set and referenced at this corner in 1884 by M.H. Buskirk, but no evidence was found of the stone or the referenced trees. A 5/8-inch rebar with a plastic yellow cap was found 0.6 feet above grade. The cap was damaged and illegible. A 1/2-inch rebar was found South 74 degrees East, 1.15 feet. The origin of both monuments are unknown. This corner is shown on Graham's 2000 survey and Curry's 2008 and 2010 surveys.

Referenced on BRG survey recorded as InstNo.2012002880

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 4

Prepared By: BRG

Date: 12/2011